









Model Number

OMT300-R200-IEP-IO-0,3M-V1-L

Distance sensor with fixed cable and M12 connector, 4-pin

Features

- Medium design with versatile mounting options
- Space-saving distance sensors in small standardized design
- Multi Pixel Technology (MPT) exact and precise signal evaluation
- IO-link interface for service and process data
- Analog output 4 ... 20 mA

Product information


The optical sensors in the series are the first devices to offer an end-to-end solution in a medium-sized standard design—from the thru-beam sensor through to the measuring distance sensor. As a result of this design, the sensors are able to perform practically all standard automation tasks.

The entire series enables sensors to communicate via IO-Link.

The DuraBeam laser sensors are durable and can be used in the same way as a standard sensor.

Multi Pixel Technology (MPT) ensures that the standard sensors are flexible and can be adapted to the application environment.

Dimensions

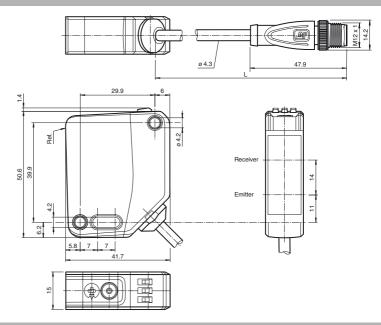

Electrical connection




Pinout

Wire colors in accordance with EN 60947





Indicators/operating means




	0	
05	M M M	Q
	,	

1	Mode rotary switch	
2	Teach-in button	
3	Switching output display Q1	
4	Operating indicator	GN

	Q1B	Switching output/switch point B
	Q1A	Switching output/switch point A
Q2A Analog ou		Analog output/value A
	Q2B	Analog output/value B
	0	Keylock

Technical data		
General specifications		
Measurement range		100 300 mm
Reference target		standard white, 100 mm x 100 mm
Light source		laser diode
Light type		modulated visible red light
Laser nominal ratings Note		LACERLICHT, DO NOT CTARE INTO REAM
Laser class		LASER LIGHT , DO NOT STARE INTO BEAM 1
Wave length		680 nm
Beam divergence		> 5 mrad, d63 < 2,8 mm in the range of 350 mm 800 mm
Pulse length		5.5 μs
Repetition rate		approx. 2.4 kHz
max. pulse energy		< 40 nJ
Angle deviation		max. +/- 1.5 °
Diameter of the light spot		approx. 3 mm at a distance of 300 mm
Angle of divergence		approx. 0.3 °
Ambient light limit		EN 60947-5-2 : 45000 Lux
Resolution		0.1 mm
Functional safety related para	meters	
MTTF _d		470 a
Mission Time (T _M)		20 a
Diagnostic Coverage (DC)		0 %
Indicators/operating means		
Operation indicator		LED green:
		constantly on - power on flashing (4Hz) - short circuit
		flashing with short break (1 Hz) - IO-Link mode
Function indicator		LED yellow:
		constantly on - switch output active
Control elements		constantly off - switch output inactive
Control elements		Teach-In key 5-step rotary switch for operating modes selection
Electrical specifications		5-step rotary switch for operating modes selection
Operating voltage	U _B	18 30 V DC
Ripple	ΟB	max. 10 %
No-load supply current	Io	< 18 mA at 24 V supply voltage
Protection class	U	
Interface		
Interface type		IO-Link (via C/Q = pin 4)
Device profile		Identification and diagnosis
		Smart Sensor type 0/type 3.3
Transfer rate		COM 2 (38.4 kBaud)
IO-Link Revision		1.1
Min. cycle time		3 ms
Process data witdh		Process data input 4 byte Process data output 2 bits
SIO mode support		yes
Device ID		0x11190B (1120523)
Compatible master port type		A
Output		
Switching type		The default setting is:
g ., p		C/Q - Pin4: NPN normally open, PNP normally closed, IO-Lini
		I—Pin2: analog output 420 mA
Signal output		1 push-pull output, 1 analog output, short-circuit-proof, rever polarity protection, surge-proof
Switching voltage		max. 30 V DC
Switching current		max. 100 mA , resistive load
Usage category		DC-12 and DC-13
Voltage drop	U _d	≤ 1.5 V DC
Response time	- a	2 ms
Analog output		
Output type		1 current output: 4 20 mA
Load resistor		> 1 kΩ voltage output ; \leq 470 Ω current output
Recovery time		2 ms
Conformity		
Communication interface		IEC 61131-9
Product standard		EN 60947-5-2
Lagarasfaty		EN 60825-1:2014
Laser safety		
Measurement accuracy		
•		0.05 %/K
Measurement accuracy		0.05 %/K 5 min
Measurement accuracy Temperature drift		
Measurement accuracy Temperature drift Warm up time		5 min
Measurement accuracy Temperature drift Warm up time Repeat accuracy		5 min < 0.5 %
Measurement accuracy Temperature drift Warm up time Repeat accuracy Linearity error		5 min < 0.5 %

Laserlabel



Accessories

V1-G-2M-PUR

Female cordset, M12, 4-pin, PUR cable

V1-W-2M-PUR

Female cordset, M12, 4-pin, PUR cable

IO-Link-Master02-USB

IO-Link master, supply via USB port or separate power supply, LED indicators, M12 plug for sensor connection

OMH-MLV12-HWK

Mounting bracket for series MLV12 sensors

OMH-R200-01

Mounting aid for round steel ø 12 mm or sheet 1.5 mm ... 3 mm

OMH-R20x-Quick-Mount

Quick mounting accessory

OMH-MLV12-HWG

Mounting bracket for series MLV12 sensors

Other suitable accessories can be found at www.pepperl-fuchs.com

Approvals and certificates	
UL approval	E87056, cULus Listed, class 2 power supply, type rating 1
CCC approval	CCC approval / marking not required for products rated ≤36 V
FDA approval	IEC 60825-1:2014 Complies with 21 CFR 1040.10 and 1040.11 except for deviations pursuant to Laser Notice No. 50, dated June 24, 2007

0.3 m

Settings

Teach-In (TI)

Cable length

Use the rotary switch for switching signal Q1 to select the relevant switching threshold A and/or B to teach in.

• The yellow LEDs indicate the current state of the selected output.

To teach in a switching threshold, press and hold the "TI" button for approximately 1 s, until the yellow and green LEDs flash in phase. Teach-in starts when the "TI" button is released.


- Teach-in successful: the yellow and green LEDs flash alternately at 2.5 Hz.
- Teach-in unsuccessful: the yellow and green LEDs quickly flash alternately at 8 Hz.

 After an unsuccessful Teach in the appear partially as the provide with the provide public as


After an unsuccessful Teach-in, the sensor continues to operate with the previous valid setting after the relevant visual fault signal is issued.

Set switching mode: you can define different switching modes by teaching in the relevant distance data for switching thresholds A and B.

1. Single point mode:



2. Window mode:



Teach in switching thresholds: you can teach in or overwrite a taught-in switching threshold at any time. To do this, press the "TI" button again.

Reset a value: you can reset a taught-in value. To do this, press the "TI" button for > 4 s, until the yellow and green LEDs go out. The reset process itself starts when the "TI" button is released.

· Reset successful: the yellow and green LEDs flash alternately at 2.5 Hz.

Minimum and maximum values for the analog output Q2 are taught in and deleted in the same way as those for the switching output. The following applies:

- A = Minimum voltage/current
- B = Maximum voltage/current

Resetting to Factory Settings

To revert back to factory settings, press the "TI" button for > 10 s with the rotary switch set to position "O," until the yellow and green LEDs go out at the same time. The reset process itself starts when the "TI" button is released.

 Reset to factory settings successful: the yellow and green LEDs light up at the same time. The sensor then continues to operate with factory settings.

OMT-IEP

295670-100321 eng.xml

2019-10-31

issue:

Date of

Release date: 2019-06-26 12:53

- Factory setting for switching signal Q1:
 Switching signal is high active, window mode
- Analog output: current output, 4 mA ... 20 mA absolute mode

OMT-UEP

- Factory setting for switching signal Q1: Switching signal is high active, window mode
- Analog output: voltage output, 0 V ... 10 V absolute mode

Analog output

The analog output type can be configured as voltage or current output via IO-Link.

The following output types are available:

- Analog output 0 mA ...20 mA
- Analog output 4 mA ...20 mA
- Analog output 0 V ...10 V

The following operating modes are available:


- Absolute mode (default setting)
- Normalized mode
- · Rising slope
- Falling slope

The following substitute values can optionally be configured:


- No substitute values used (default setting)
- Substitute value for "no measured value" used
- Substitute value for "no measured value" and "Measuring overrange" used

The sensor's tolerances are based on the digital process data.


Absolute mode (default setting, A and B = deleted)

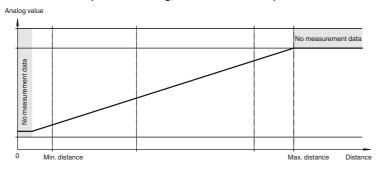


Normal mode (A and B without teach-in / deleted)

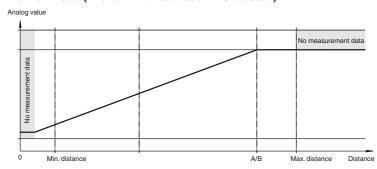

Rising slope (A < B)

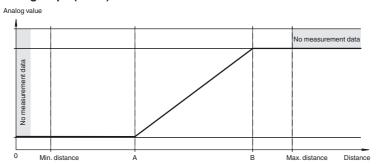

Falling slope (A > B)

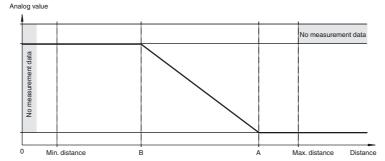

Configuration via IO-Link interface

Setting different operating modes via the IO-Link interface

The devices are equipped with an IO-Link interface as standard for diagnostics and parameterization tasks to ensure optimum adjustment of the sensors to the relevant application.

Single point mode operating mode (one switch point):

- "Detection of objects irrespective of type and color in a defined detection range. Objects in the background are suppressed.
- "The switch point corresponds exactly to the set point.




Window mode operating mode (two switch points):

- · Detection of objects irrespective of type and color in a defined detection range. Reliable detection when object leaves the detection range.
- · Window mode with two switch points.




Center window mode operating mode (one switch point):

- Detection of objects irrespective of type and color in a defined detection range. Sets a defined window around a given object. Objects outside this window are not detected.
- · Window mode with one switch point.



Two point mode operating mode (hysteresis operating mode):

• Detection of objects irrespective of type and color between a defined switch-on and switch-off point.



Inactive operating mode:

• Evaluation of switching signals is deactivated.

The associated IODD device description file can be found in the download area at www.pepperl-fuchs.com.