## **SIEMENS**

## **Data sheet**

## 3WL1220-4CB34-1AJ2-Z C22+K07+M06

fixed-mounted circuit breaker 3-pole, size II, IEC In=2000A to 690V, AC50/60Hz Icu=100kA at 500V frnt.conn. top/bot. dual-hole Overcurrent release ETU 25 LSI protection adjustable 0.4-1 in With manual operating mechanism with storage with mechanical request without 1st auxiliary release With 2nd auxiliary release "R", F3 Undervoltage, instant. 24 V DC 2NO+2NC C22= Ready indicator K07= Tripped signaling contact, 1 CO not possible with option F02 M06= Motor drive, Drive motor AC 50/60 Hz 208-240 V or 220-250 V DC

## Further information

Information on the packaging

https://support.industry.siemens.com/cs/ww/en/view/109813875

Industry Mall (Online ordering system)

https://mall.industry.siemens.com/mall/en/en/Catalog/product?mlfb=3WL1220-4CB34-1AJ2-Z C22+K07+M06

Service&Support (Manuals, Certificates, Characteristics, FAQs,...)

https://support.industry.siemens.com/cs/ww/en/ps/3WL1220-4CB34-1AJ2-Z C22+K07+M06

Image database (product images, 2D dimension drawings, 3D models, device circuit diagrams, ...) <a href="http://www.automation.siemens.com/bilddb/cax">http://www.automation.siemens.com/bilddb/cax</a> en.aspx?mlfb=3WL1220-4CB34-1AJ2-Z C22+K07+M06


CAx-Online-Generator

http://www.siemens.com/cax

Tender specifications

http://www.siemens.com/specifications



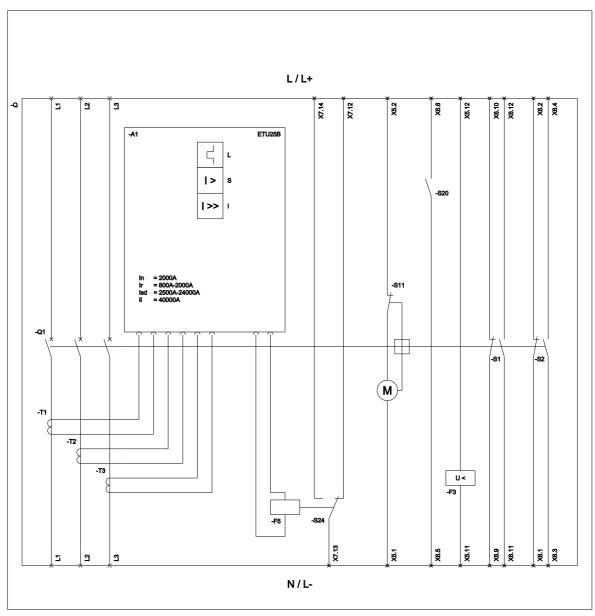

L (Long Time Delay / Oberlastschutz); S (Short Time Delay / Kurzschlussschutz, kurzzeitverzögert); I (Instantaneous / Kurzschlussschutz, unverzögert);
S11 (Instantaneous / Kurzschlussschutz, unverzögert);
S11 (Instantaneous / Kurzschlussschutz, unverzögert);
F5 (Magistch for trip unit / Auslösemagnet); S1 - S8 (Auxiliary switch / Hilfsschalter);
S20 (Ready to close signalling switch / Einschaltbereitschaftsmeldeschalter);
S24 (1st trip signalling switch K07 (Reset position) / Erster Ausgelöstmeldeschalter K07 (Reset Position));

last modified: 4/17/2024 🖸